



Service Bulletin

Date: Sept 25, 2000

Bulletin No: 01-03A

Product Line: ATV

Affected

Model(s): 2000 500 Automatic - All
2001 500 Automatic - See VIN Range Below

VIN:

2000 500 Automatic - Not Applicable
2001 500 Automatic - L81T300001-
P91T305615

Subject: Clutch Plenum Vent Boot

Condition: It has been determined that when the affected ATV's are ridden through shallow water at moderate to high speeds, the rear tires may cause water to enter the rear clutch plenum vent boot and then flow downward into the clutch housing.

Solution: Loosen the clamp securing the existing clutch plenum vent boot; then rotate the boot until the open end of the boot faces forward. See Fig. 1. Secure the boot with the existing clamp.


Warranty: A labor allowance of 0.2 hr will be paid per affected ATV.

A Warranty Claim Form of up to 10 vehicle identification numbers (VIN) will be accepted.

Enter 01-03A in the Failure Code section of the Warranty Claim Form.

Enter 0 in the Parts section of the Warranty Claim Form.

Fig. 1

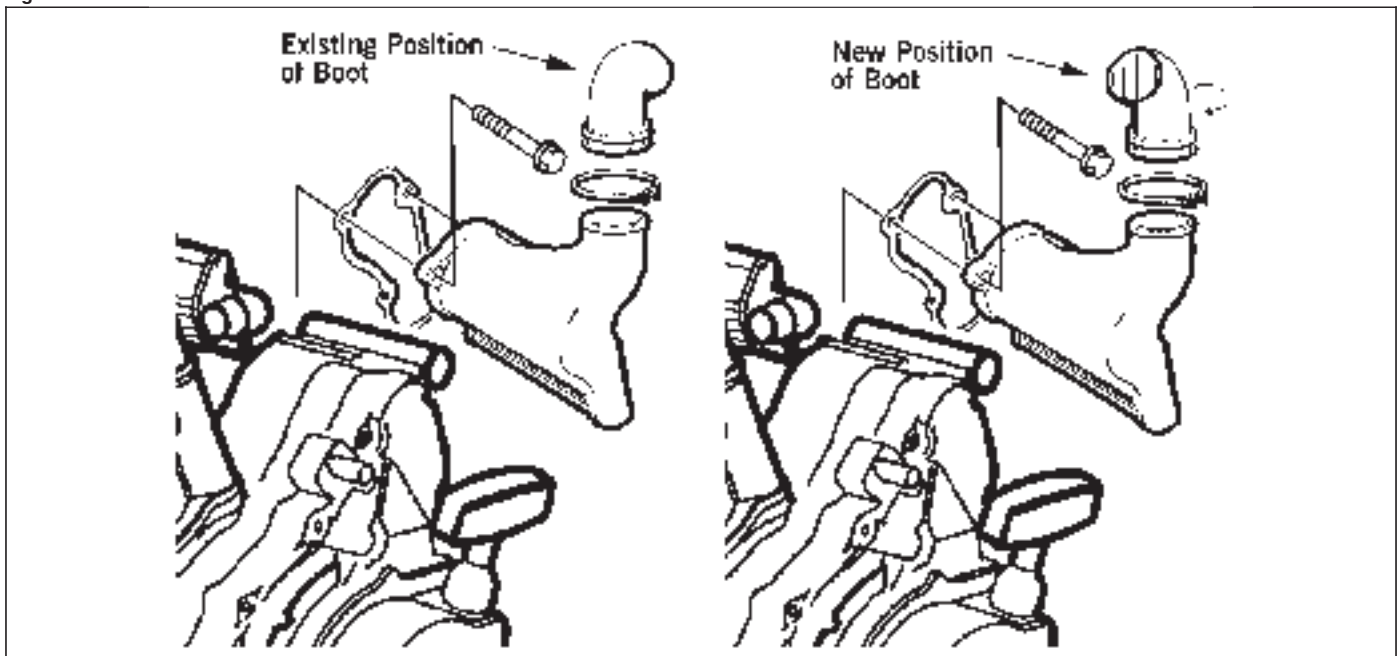

0000-125

