



# Product Safety Recall Bulletin

**Date:** June 25, 2008

**Product Line:** ATV

**Subject:** Carburetor

**Bulletin No:** 2009-2-01 (50 cc Condition A) (90 cc Condition B)

**Affected Models:** All 2008 Arctic Cat 50 cc and 90 cc models

## What is the reason for this notice?

In cooperation with the Canadian Department of Transport, Arctic Cat is voluntarily recalling the ATV's identified above for necessary service work.

Immediately stop selling the affected ATV's until the necessary service work has been completed.

**Condition A & B:** On some of the affected ATV's, the speed controller valve alignment pin in the carburetor may not be properly seated and could move providing an opportunity for the slide valve to not return to the idle position. Operation of the vehicle can cause the throttle to not function properly which will then not return to the idle position. If this condition exists, loss of throttle control may occur resulting in possible bodily injury or death.

**Solution A:** Install Carburetor Kit (p/n 1436-294) for all 2008 DVX 50 and 50 Utility models according to the instructions included in the kit.

**Solution B:** Install Carburetor Kit (p/n 1436-293) for all 2008 DVX 90 and 90 Utility models according to the instructions included in the kit.

## ⚠WARNING

Do not operate or permit anyone to operate an affected vehicle until the appropriate carburetor has been replaced.

## What should you do?

Please contact all customers who have taken possession of an affected vehicle. Be sure to complete the necessary service work before releasing any more affected vehicles to customers.

■ NOTE: Arctic Cat will also contact all registered owners concerning this issue .

**Parts:** Order an appropriate number of Carburetor kits for DVX 50 and 50 Utility models (p/n 1436-294), DVX 90 and 90 Utility models (p/n 1436-293) through normal parts-ordering channels. Your dealership Parts Account will be billed and then credited upon receipt of a Warranty Claim Request form.

**Warranty:** A labor allowance of 0.5 hr will be paid per affected ATV.