



Service Bulletin

Date: October 10, 2002

Product Line: Snowmobile

Bulletin No: 2003-1-13

Subject: Speedometer Cable Routing

Affected Models / VIN:

2002 4-Stroke (All)

2002 4-Stroke Trail
Model No. S2002ACFLCUSG

2002 4-Stroke Touring
Model No. S2002ACFERUSG
Model No. S2002ACFEROSG (International)

Condition: It has been determined that the speedometer cable on the affected models may come into contact with the top of the air silencer plenum causing possible damage to the cable.

Solution: Disconnect the speedometer cable; then reroute the cable behind the hood harness making sure the cable slack is pulled toward the gauge. Connect the speedometer cable. See Fig. 1 for proper routing.

Also install Belly Pan Guide (p/n 0619-611) on each side of the belly pan near the rear of the belly pan. See Fig. 2 for the proper location of the guide.

Fig. 1


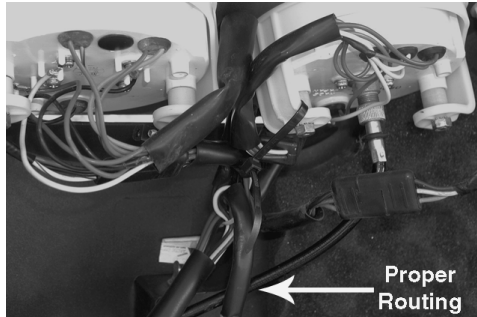


Fig. 2

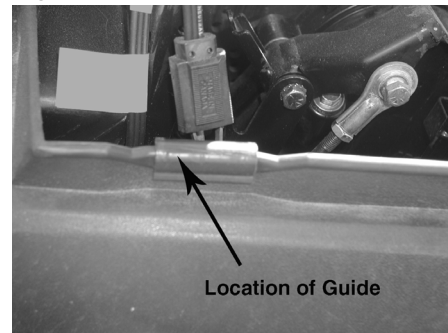

■ **NOTE:** Installing the belly pan guides will raise the hood slightly, allowing more clearance between the speedometer cable and the top of the air silencer plenum.

Parts: Order an appropriate number of Belly Pan Guides (p/n 0619-611) through normal parts-ordering channels. Your dealership Parts-Account will be charged and then credited upon receipt of a Warranty Claim Request form.

Warranty: A labor allowance of 0.2 hr will be paid per affected snowmobile.

Only one vehicle identification number (VIN) can be entered per claim. Do not enter a group claim.

CatTracker Claim: Enter BS200313 in the Complaint section.

Manual Claim: Enter 0313 in the Complaint section.



Printed in the U.S.A.



®™ Trademarks of Arctic Cat Inc., Thief River Falls, MN 56701



1002