



Service Bulletin

Date: November 11, 2002

Product Line: Snowmobile

Bulletin No: 2003-1-17

Subject: Improper Gasline Hose Routing

Affected Models / VIN:

Model: 2003 Mountain Cat 900 (159 in.)


Model No. S2003MCJC9USB (Black - Orange 159)

VIN Range: 4UF03SNW73T313235 - 4UF03SNW23T313398

■ **NOTE:** For identification purposes, it is necessary to refer to only the last six digits of the vehicle identification number.

Condition: It has been determined that existing Gasline Hose (p/n 0610-016) between the gas tank and the fuel pump was incorrectly routed and secured to the driven shaft protector bracket. This incorrect positioning will cause the hose to wear against the bracket resulting in severe damage to the hose. See Fig. 1 for the improper routing and positioning of the hose.

Fig. 1

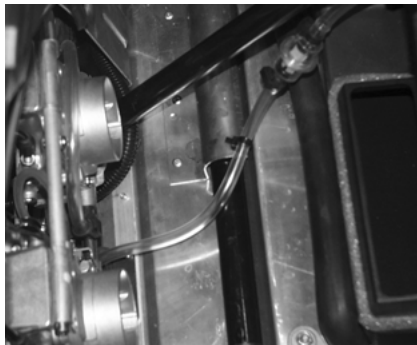

Solution: Inspect all affected snowmobiles to determine if the gasline hose is improperly routed and secured to the driven shaft protector bracket.

■ **NOTE:** To obtain easy access to the gasline hose, it is recommended that the air silencer assembly be moved forward.

If the hose is improperly routed and secured (see Fig. 1), remove the gasline hose from the cable tie.

■ **NOTE:** When the hose is properly routed and not secured to the bracket, the hose should lie under the steering post and along side the air silencer assembly (not underneath).

Parts: Not Applicable

Warranty: A labor allowance of 0.2 hr will be paid per affected snowmobile.

Only one vehicle identification number can be entered per claim. Do not submit a group claim.

CatTracker Claim: Enter BS200317 in the Complaint section.

Manual Claim: Enter 0317 in the Complaint section.

Enter 0 in the Quantity section.



Printed in the U.S.A.



®™ Trademarks of Arctic Cat Inc., Thief River Falls, MN 56701



1102