



TECHNICAL SERVICE

BULLETIN

DEALER INFORMATION, TECHNICAL
ADVICE AND PRODUCT INFORMATION
CAN BE OBTAINED AT THIS NUMBER

1 - 8 0 0 - 4 3 8 - 9 4 7 5

NO. H00A-003

**SUBJECT: PRODUCT IMPROVEMENTS CHAIN SAWS
AIR LEAK**

AFFECTS: THE FOLLOWING MODELS

3300	UT10779,A	UT10782	UT10784,A	UT10786	UT10799R	UT10799R1	UT10809
	UT10882	UT10880	UT10857	UT10855	UT10828	UT10821	
20	UT10782A	UT10786	UT10817	UT10818	UT10847	UT10881	UT10883
PS33	UT10788	UT10819					
3350	UT10759	UT10767,A	UT10768,A	UT10771	UT10774,A	UT10775,A	UT10840
	UT10868						
20AV	UT10759A	UT10771A	UT10856				
ALL AMERICAN	UT10790						
2014	UT10797R						
3800	UT10780,A	UT10781	UT10783,A	UT10785	UT10800R		
23	UT10781A	UT10785A	UT10815	UT10842	UT10870		
3850	UT10769,A	UT10770,A	UT10772	UT10773	UT10758,A	UT10776,A	UT10798R
	UT10798R1	UT10824	UT10833	UT10837	UT10838	UT10841	UT10861
	UT10865	UT10866	UT10869	UT10886	UT10887		
23AV	UT10772A	UT10773A	UT10820	UT10822	UT10823	UT10827	UT10829
	UT10830	UT10831	UT10835	UT10858	UT10884	UT10885	UT10888
4150	UT10801	UT10802	UT10808	UT10839	UT10867		
4550	UT10787	UT10807	UT10825	UT10826	UT10832	UT10834	UT10836
	UT10860	UT10862	UT10864				
25AV	UT10803	UT10804					
27AV	UT10805	UT10825	UT10827	UT10830	UT10831	UT10835	UT10859
	UT10863	UT10874					
S1035	UT10775B	UT10843					
S1040	UT10776B	UT10844					
S1045	UT10816	UT10845	UT10873				

On the previously listed affected models, the possibility of an air leak between the heat dam gasket and the cylinder has been detected. In manufacturing, Loctite 510 is being used to seal this area. If a saw is acting like its running lean, has poor acceleration, has unstable carburetor adjustments or has a fluctuating idle speed, it could have an air leak. To correct an air leak, sparingly apply a bead of Loctite 510 to the cylinder and install the gasket and heat dam. Be careful not to plug the pulse hole with Loctite.

Failures of this type are covered by warranty. Use failcode FF17 when filling out the warranty claim

DATED: 01/00