





SERVICE 		6 B0200028
--	--	-----------------------------

English 1 (1)

SB, 265 RX, Starter, 2002-08

To increase the life of the pulley bearing the thickness of the plastic sleeve 501 40 72-01 has been increased. The inner diameter has been reduced.

This means that the steel bushing 501 40 27-01 has a smaller outer diameter.

Washer 501 40 89-01 has also been integrated with the steel bushing. The washer is therefore no longer available.

Because the plastic sleeve and steel bushing cannot be replaced separately they are now available as a kit.

New part no.	Description	Excl. part no.	Remark
537 22 61-01	Pulley bushing kit		
	Steel bushing	501 40 27-01	
	Plastic sleeve	501 40 72-01	
	Washer	501 40 89-01	

Introduced from serial number:	265 RX	021900025
	265 RX EPA Can	022200001

