





| | | |
|--|--|-----------------|
| SERVICE  |  | 8 |
| | | B0200052 |

English 1 (1)

SB, 325 HS 75, 325 HS 99, Cylinder cover, 2002-06

Under certain conditions the screws that hold the cylinder cover and starter have been found to lose their torque, which results in damage to the cylinder cover, starter or crankcase. To rectify this problem the glass fibre content in the cylinder cover has been increased, revision L. This means that the material is not compressed as easily as before and the screws will not lose their torque. A special screw that is coated with locking fluid has also been brought out.

| New part no. | Description | Excl. part no. | Remark |
|--------------|--------------------------|----------------------------------|------------|
| 537 06 24-02 | Cylinder cover | | Revision L |
| 503 21 62-20 | Screw with locking fluid | { 503 21 68-20 { 503 21 75-20 | |

