





SERVICE 		1
		B0300004

English 1 (1)

SB, 371 K, 3120 K, Crankshaft, 2003-01

The clutch drum bearing on both power cutters is lubricated by the two-stroke oil in the fuel mixture. The oil reaches the bearing via a channel in the crankshaft. To further improve lubrication of the clutch drum bearing the crankshaft is fitted with a non-return valve.

The non-return valve prevents the oil from pulsing back and forth as a result of the alternating pressure and vacuum that occur in the crankcase. In order to pressure test the crankcase the channel must first be sealed. Parts are fully interchangeable.

NOTE! On the 371 K the change only applies to the power cutter crankshaft.

Introduced from serial number:	371 K	023600092
	3120 K	022500001

New part no.	Description	Excl. part no.	Remark
503 72 91-79	Crankshaft 371 K	503 72 91-73	
503 14 20-73	Crankshaft 3120 K/XP	503 14 20-72	

