



**Service
Bulletin**


**B0303010
2003-6**

Subject: Gen II and BAM Deck Belt Adjustments

Service Information:

Decks used on the Gen II and BAM allow for belt adjustment. Belt adjustment will reduce belt vibrating and bouncing concerns.

The thinner fixed idler on the mower deck, part number 539 103257, can be adjusted to add tension to the deck belt to eliminate belt bounce. This idler mounts thru the deck usually in the forward most or center of three hole locations illustrated below.

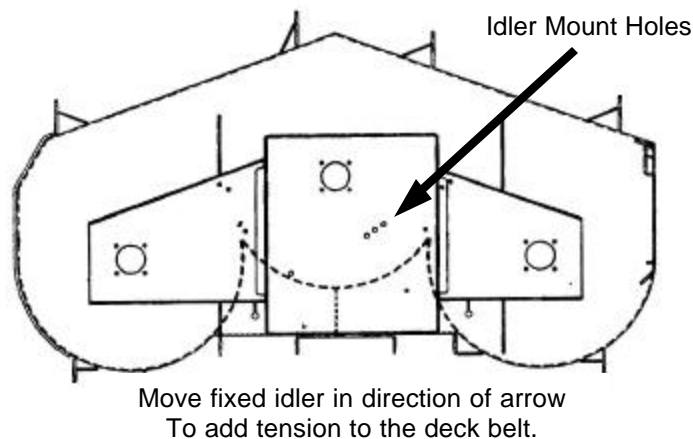

To add tension, remove the deck belt; remove the thin fixed idler, and move it left and rearward by one hole location. Reinstall the mower deck belt.

Parts - Warranty:

No parts are necessary. This is service information only so warranty does not apply.