



SERVICE 		7
		X 90.103-26

MODELS **61, 66, 266, 268**

New oil tank ventilation type 254

The present sinter plug under the silencer is replaced by a plastic hose and a spring tubular pin with outlet in the bar pad area of the crankcase. An oil leakage will then occur on a place which is more hidden. In the protection plate Ref. no. 501 81 48-01, a groove is added (see illustration).

New Ref. no.	Description	Excluded Ref. no.	Remark
721 42 32-50	Spring tubular pin		
501 83 93-01	Plastic hose		268
501 83 93-03	Plastic hose		61, 66, 266
	Sinter plug	501 83 94-01	R

R = remains as a spare part

The change is introduced from the following serial number:

- 61 -0160699
- 266 -0141468
- 268 -0160226

