



SERVICE 		1
		X 95.007-26

Model 250R/RX

Clutch

A degree of clutch slip is caused when the clutch is exposed to heavy loading, e.g. when using the trimmer head with heavy gauge cord. This creates heat which can damage the Teflon bushings on the clutch shoes. There is a new bushing now available as an option that is manufactured of bearing bronze and can withstand a higher temperature.

New Ref. No.	Description	Excl. Ref. No.	Remark
502 27 78-01	Bronze bushing	-	

