



**Service  
Note**



**N0203018**

**2002-09**

---

**Subject:** HYDRAULIC SYSTEM REPAIR

**Effected Model Numbers:** All Commercial Hydro Drive Mowers

---

**Service Information:**

On all Commercial Hydro Drive Mower hydraulic systems, anytime there is a confirmed hydraulic pump failure, the same side hydraulic wheel motor **MUST** be removed, marked, disassembled, thoroughly cleaned, and resealed. Seal kits for the small "TE" motors can be used with either the 5 or 6 bolt motor.

Because the Gen II and XP large frame, and the intermediate iZ riders have a new, larger, "TF" Ross Hydraulic Motor, a separate seal kit part number is required.

**Parts Information:**

All Gen II, XP and iZ Units.

**P/N 539106068** - Seal Kit, "TF" Hydraulic Motor

All Mini ZTH and Walk-Behind Hydro Units.

**P/N 539103664** - Seal Kit, "TE" Hydraulic Motor (includes 6 Grade 10 tie bolts)

**Warranty Information:**

Information only. Normal warranty policy applies.