



SERVICE  
BULLETIN  
127  
INFORMATIONAL

**ISSUED:** June 2000

**MODELS OR TYPES AFFECTED:** OHV 13.5HP – OHV 17.5HP

**SUBJECT:** Cracked Rocker-Arm Bearings

We have developed a new Rocker-Arm Bearing Kit part number **730636** to address field concerns of rocker-arm bearing breakage. This typically is caused by over-torquing the Allen lock screw during adjustments. The kit includes longer rocker arm studs, jam nuts to replace the Allen lock screws and new rocker-arm bearings.

A detailed and easy to follow instruction sheet is included with every kit.

To simply replace the cracked rocker-arm bearings and set screw could result in the same problem reoccurring. The **Rocker-Arm Bearing Kit** part number **730636** can be ordered from your normal source of supply.

**OLD STYLE**

**NEW STYLE**

