


**SERVICE
BULLETIN
402
4 CYCLE**

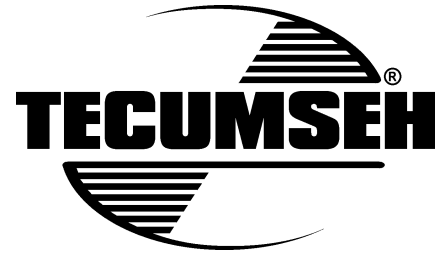

ISSUED: January 1991

REVISED: June 1995

SUBJECT: Procedure for Addressing High Altitude on OH Engines


MODELS OR TYPES AFFECTED: All Fixed Jet Walbro Carburetors on OH120 thru OH180 Engines.

On occasions high altitude has affected the operation of high and low speed performance.

1. Remove air cleaner assy.
2. Remove choke shaft assy.
3. Using an ice pick type tool with a small hook on the end remove the brass cup plug out of the nozzle well vent.

NOTE: DO NOT USE A THREAD TAP AS CHIPS MAY ENTER THE CARBURETOR

4. Reassemble choke shaft assy.
5. Reinstall air cleaner assy.

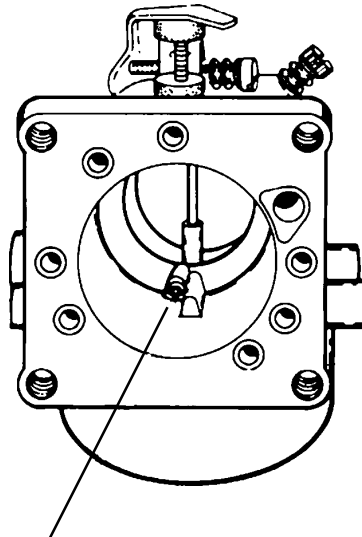

REMOVE CHOKE LEVER ASSY.
NOTE BRASS CUP PLUG