



ISSUED: April 1994 **REVISED:** June 1995

SUBJECT: VLV50,55 Fuel Starvation

MODELS OR TYPES AFFECTED: VLV50, 55 engines with date codes between 2306 and 3213

SYMPTOMS: The engine stops after running a short time. The engine will restart after sitting a few seconds.

CORRECTION: Kit #730235

- DO NOT REMOVE THE CARBURETOR

- Drain the fuel from the tank and carburetor
- Release the carburetor bowl retaining bail and remove the bowl assembly. Release the fuel line clamp and remove the fuel line.
- Install the new bowl assembly (in kit).
- Install in-line fuel filter (in kit) by cutting a section from the middle of the fuel line (approximately 1-1/4"). The arrow on the filter must point towards the carburetor.
- USE THE FUEL LINE CLAMPS PROVIDED WITH FILTER.