



**SERVICE
BULLETIN
501**

**EMISSION
INFORMATION
UNITED STATES ONLY**

ISSUED: June, 1998

FAMILY: STP185U1G1RA

ENGINE MODEL(S) CONCERNED: LEV115

D.O.M. (S) AFFECTED: 8091-8166

Tecumseh Products Company, in cooperation with California Air Resource Board (CARB) and the US Environmental Protection Agency (EPA), needs your assistance.

Potential Emission Control System Problem:

The testing of engines manufactured in compliance with these regulations has identified a potential emission control system problem. The potential area of concern (outlined below) should be inspected when equipment is received for normal servicing.

Should the inspection reveal the engine has the concern outlined, repair the unit as instructed. After completion of the repair, file for warranty reimbursement, using the ESA 157 claim form.

Affected specifications numbers are:

350007A,B,C,	350010B,	350013B,	350041B,C,	350042C,	350063C,
350064C,	350075C,	350083C,	350086C,	350087C,	350089C,
350098C,	350099C,	350110C,	350112C,	355001A,	355003A,B,C,
355004B,	355010C,	355011C,	360002A,	360003A,	360004A,
360006A,	360009A,B,	360010B,	360011B,	360017B,	360018B

Warranty Inspection and Repair Procedure:

Inspect models in stock or that come in for service to determine high speed bowl nut number (stamped on bottom).

If stamped with #174, replace high speed bowl nut with #169 (part number 640087).

If stamped with #169, no change is required.