

**SERVICE
BULLETIN
502**

**EMISSION
INFORMATION
UNITED STATES ONLY**



ISSUED: August, 1998

FAMILY: TTP156U1G1EB

ENGINE MODEL(S) CONCERNED:

Compact H35 & H40

D.O.M. (S) AFFECTED:

8079-8201

Tecumseh Products Company, in cooperation with California Air Resource Board (CARB) and the US Environmental Protection Agency (EPA), needs your assistance.

Potential Emission Control System Problem:

The testing of engines manufactured in compliance with these regulations has identified a potential emission control system problem. The area of concern (outlined below) should be inspected when equipment is received for normal servicing or if the customer complains of poor engine performance.

Should the inspection reveal the engine has the concern outlined, repair the unit as instructed. After completion of the repair, file for warranty reimbursement, using the ESA 157 claim form.

Affected specifications numbers are:

H35-45690Z, H35-45726Z, H40-55701A

Warranty Inspection and Repair Procedure:

Should you have one of the above mentioned units please check for previous repair. This is accomplished by locating the carburetor model number as shown (see illustration.) If the carburetor model number is **5015** it will be necessary to replace the carburetor.

If the engine has already been repaired the carburetor model number **5161** will be present in the same location, and this **bulletin does not apply**.

To complete the repair order replacement carburetor number **640172** from your usual source of supply. The usual time for this repair is 30-45 minutes which includes completely filling out the ESA 157 warranty claim.

