


For Husqvarna Parts Call 606-678-9623 or 606-561-4983

 **Husqvarna**
Product Service Bulletin

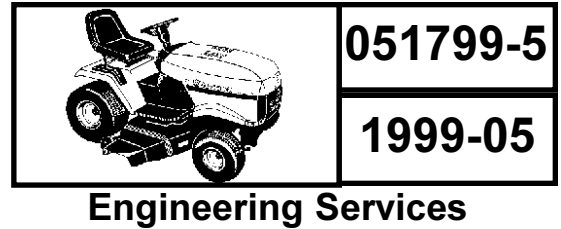

Models Affected:

YT - 42" Units

Serial Numbers: 42" decks using four gauge wheels.

Issue Reported: Premature deck belt failure, particularly when in low cut applications.

Action Required: Verify proper deck leveling, with a pitch of 1/4 to 3/8 in the normal cutting position. Insure that the deck gauge wheels are not touching the ground in the cutting position. Raise the gauge wheels if necessary to obtain at least a 1/2 inch clearance between the ground and the bottom of the wheel. If the problem still persists, install Service Kit part # 532 159548.