



# Service Bulletin

**Date:** August 8, 2005

**Product Line:** Snowmobile

**Bulletin No:** 2006-1-01

**Subject:** Gas Tank Neck Extension

## Affected Models/VIN Range:

2006 M7 models within the VIN range of 4UF06SNW96T111797 - 4UF06SNW06T112997

2006 Crossfire models within the VIN range of 4UF06SNW46T113280 - 4UF06SNW26T115934

---

■ **NOTE:** To determine if a snowmobile is affected, be sure that the snowmobile is one of the models listed above; then check the VIN of the snowmobile to see if it is within the corresponding VIN range(s). It is necessary to check only the last six digits of the VIN. If the snowmobile(s) was shipped prior to 7/8/05, the snowmobile(s) is affected by this bulletin. Snowmobiles shipped on 7/8/05 or later are not affected by this bulletin and will be equipped with a gas tank neck extension.

**Condition:** Due to unforeseen circumstances, Gas Tank Neck Extension (p/n 1670-801) was not available during the production of the above models; consequently, some of the affected snowmobiles were shipped without the extension installed.

**Solution:** Install Gas Tank Neck Extension (p/n 1670-801) per instructions included with this bulletin.

**Parts:** An appropriate number of extensions are being sent to each dealer who was shipped snowmobiles without the extension. Your dealership Parts Account will be billed and then credited upon receipt of a Warranty Claim Request form.

■ **NOTE:** Do not order parts through normal parts-ordering channels at this time. An appropriate number of extensions will be sent directly to all the dealers affected by this bulletin.

**Warranty:** A labor allowance of 0.2 hr will be paid per affected snowmobile.  
Claim: Enter BS200601 in the Complaint section.

■ **NOTE:** Please remember that when submitting a claim, make sure to always enter the current mileage of each affected snowmobile. In order for Arctic Cat to accurately assess warranty claims, an accurate recording of mileage on snowmobiles with warranty claims is important.

## ATTENTION

To ensure that the necessary service work is completed in a timely manner and that this issue can be resolved, Arctic Cat is requesting that all service work be completed prior to August 8, 2006. All warranty claims directly related to this issue will not be honored after August 8, 2006.

## Installation Instructions

1. Remove the gas tank cap; then insert Gas Tank Neck Extension (p/n 1670-801) into the gas tank neck by carefully pushing it downward until it is seated. See Fig. 1 and Fig. 2.


■ **NOTE:** Push the extension into the gas tank neck by hand only. Do not use a hammer or any other tool. When seated into the gas tank neck, the top of the extension should be approximately 1/8 in. below the top edge of the gas tank neck.

Fig. 1



SNO-030

Fig. 2

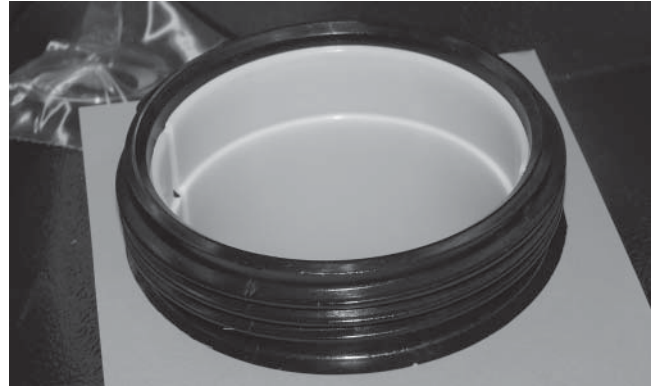

SNO-031

